



Spindelende des Kunden
customers spindle end

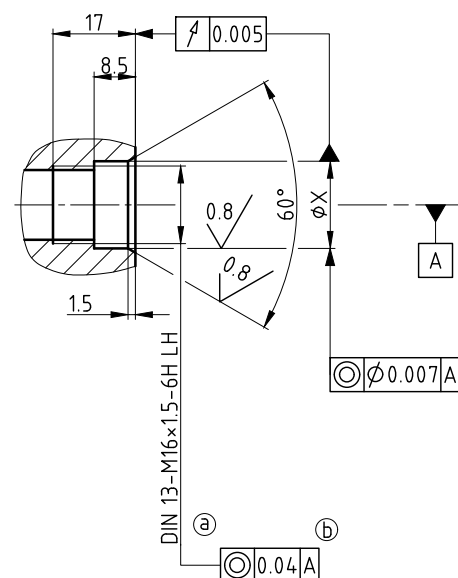

Radial Version

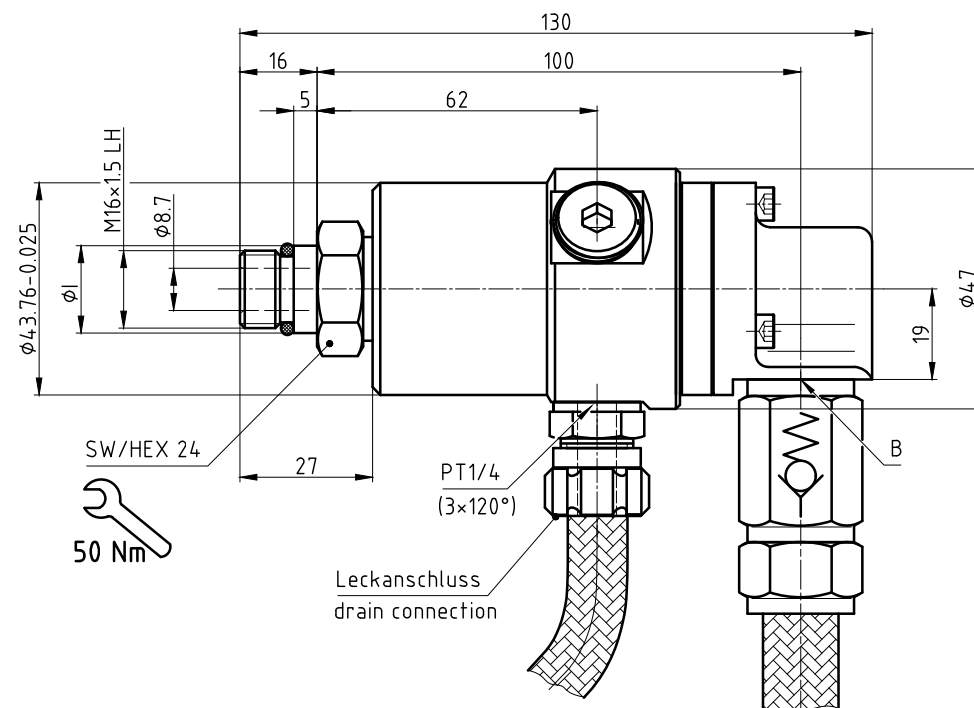

ACHTUNG !
Zuerst Rückschlagventil, Schlauch
und Leckleitung an Einführung
montieren, dann Rotor fest in
Spindelende einschrauben!

ATTENTION !
Connect check valve, hose and
drainline to the Union first, than
mount the Union to the spindle end!


HINWEIS:

1. Bei vertikal montierter Einführung darf die Leckleitung nicht höher als der Leckleitungsanschluß liegen.
2. Bei horizontal montierter Einführung die Leckleitung auf 6 Uhr-Position anschließen.
3. Rückschlagventil empfohlen (vom Kunden beigestellt).

NOTES:

1. When mounting the UNION in the vertical position the drain line must be positioned no higher than the vent hole.
2. When mounting in the horizontal position the drain line must be positioned downward (6 o'clock).
3. Check valve recommended (supplied by customer).

DIAGRAMM / DIAGRAM

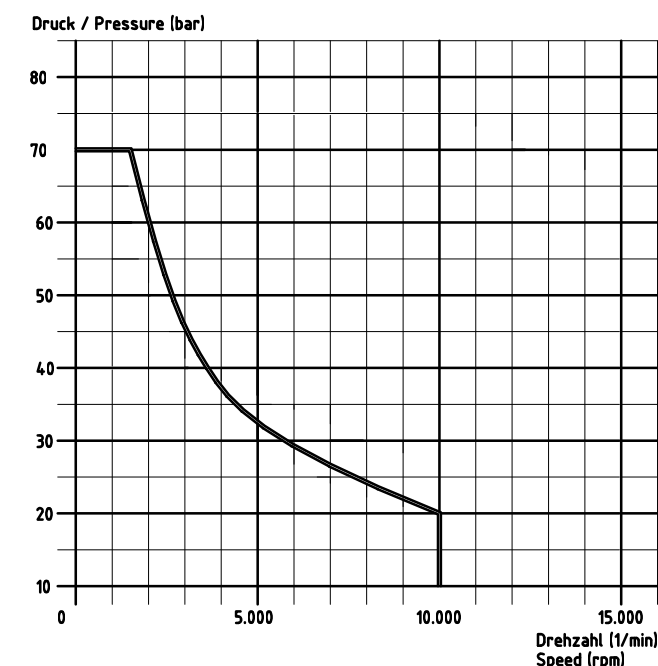

Version	B	Bestell-Nr. Ordering Nr.	ϕ I PT	ϕ X	* p max. PSI / bar	* n max. 1/min	t max. °F / °C	Q max. GPM / l/min	Filterung Filtration μ m	Trockenlauf (Lauf ohne jegliches Medium) ist möglich Dry run (run without media) is possible
Radial	PT3/8	902-180-388	17,993 / 17,988	18,000 / 17,995	1,000 / 70	10,000	160 / 70	13,8 / 50	60	* Max. Druck und max. Drehzahl gleichzeitig sind zu vermeiden. Zuordnung siehe Diagramm. * Operation at max. pressure combined with max. speed should be avoided. If your conditions are close to these limits look on the diagram.

 DEUBLIN GmbH D-65719 HOFHEIM-WALLAU, GERMANY		PROJECTION: 	SCALE: 1:1 z:\unions\
DATE: 21.02.2007 NAME: CW ENGR: 21.02.2007 HJH APPD.		TITLE: DEUBLIN ROTATING UNION DEUBLIN Drehdurchführung	
A PATENT STAMP REMOVED D 37034 05/16 FD ISSUE MODIFICATION ECO DATE SIGN		NO. 902-180-388-DD	
UNLESS SPECIFICALLY TOLERANCED, ALL DIMENSIONS ARE CONSIDERED REFERENCE		SHEET	